

Manhole Inspection Summary

Manhole # S41A__019MH

Printed On: 1/22/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **41A** Node: **019** Status: **Found**

Insp Date: **6/26/08 11:38 AM**

Incomplete Comments

Crew: **dd**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **1254 lindenle ct**

Cross Street: **n central ave**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)
5

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **8** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S41A__019MH

Printed On: 1/22/2009

Page 2 of 4

Location View




Top View



top view & steps

Defect 2

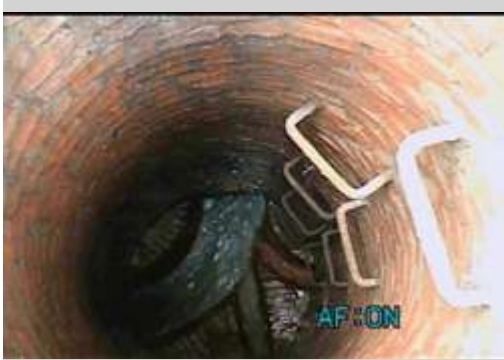

corroded steps

Defect 1



cracked deteriorating chimney, frame adj

Manhole Inspection Summary

Manhole # S41A__019MH

Printed On: 1/22/2009

Page 3 of 4

21 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.95** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.11** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop In @ 3 O'Clock



Drop: **Outside Direct**

Angled: Reading: **0.00** (ft.)

Inv Depth: **14.10** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S41A__019MH

Printed On: 1/22/2009

Page 4 of 4

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.10** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **Outside Direct**

Angled: Reading: **0.00** (ft.)

Inv Depth: **14.15** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

21 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.90** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection